



AOM PROPERTY INSPECTION SOLUTIONS HOME INSPECTION REPORT

24831 Richmond St
Dearborn, MI 48124

Bryan Blackburn
08/03/2023



Inspector

John Micheli

InterNACHI Certified Professional Inspector:

#122031413

3135108635

jmicheli@aomengineering.com

TABLE OF CONTENTS

1: Inspection Detail	5
2: Exterior	6
3: Roof	10
4: Chimney, Fireplace, or Stove	13
5: Basement, Foundation, Crawlspace & Structure	15
6: Heating	17
7: Cooling	18
8: Plumbing	19
9: Electrical	21
10: Attic, Insulation & Ventilation	23
11: Bathrooms	24
12: Doors, Windows & Interior	25
13: Laundry	27
14: Detached Garage	28
15: Kitchen	32
Standard of Practice	33

www.aominspections.com

SUMMARY



ITEMS INSPECTED



MINOR DEFECT



MAJOR DEFECT

Summary of Property Inspection Report

-  2.2.1 Exterior - Walkways & Driveways: Driveway: Minor Cracking
-  2.4.1 Exterior - Eaves, Soffits & Fascia: Missing downspout extensions
-  2.5.1 Exterior - Vegetation, Surface Drainage, Retaining Walls & Grading: Tree Debris on Roof
-  2.6.1 Exterior - Exterior Doors: Screen Door Defect
-  3.2.1 Roof - Roof Covering: Roof: Discoloration Stain from Algae
-  3.5.1 Roof - Gutters & Downspouts: Debris in Gutters
-  4.1.1 Chimney, Fireplace, or Stove - Masonry Chimney: Chimney Rain Cap Missing
-  12.7.1 Doors, Windows & Interior - Presence of Smoke and CO Detectors: Missing Smoke Detector
-  12.7.2 Doors, Windows & Interior - Presence of Smoke and CO Detectors: Missing CO Detector
-  14.7.1 Detached Garage - Electric/GFCI Outside Garage: Missing GFCI
-  14.14.1 Detached Garage - Electric in the Garage: Missing GFCI-Protection in Garage

1: INSPECTION DETAIL

Information

Occupancy

Occupied, Furnished

Style

Cape Cod

Type of Building

Single Family

Temperature (approximate)

80 Fahrenheit (F)

Weather Conditions

Sunny

Garage Size

2 Car

In Attendance

Client, Home Owner

I prefer to have my clients with me at the end of my inspection so that we can discuss concerns, and I can answer all questions.

Details

InterNACHI is so certain of the integrity of our members that we back them up with our **\$10,000 Honor Guarantee**.

InterNACHI will pay up to \$10,000 USD for the cost of replacement of personal property lost during an inspection and stolen by an InterNACHI-certified member who was convicted of or pleaded guilty to any criminal charge resulting from the member's taking of the client's personal property.

For details, please visit www.nachi.org/honor.

2: EXTERIOR

Information

General: Exterior Was Inspected

I inspected the exterior of the house.

General: Inspection Method

Visual, Drone

Walkways & Driveways:

Driveway: Material

Concrete

Walkways & Driveways: Walkway: Material

Concrete

Walkways & Driveways: Patio: Material

Pavers

Exterior Doors: Exterior Doors Inspected

I inspected the exterior doors.

Exterior Doors: Exterior Entry Door

Wood

Porches, Patios, Decks, Balconies & Carports: Appurtenance

Front porch

Front Porch

Porches, Patios, Decks, Balconies & Carports: Material

Concrete

General: Homeowner's Responsibility

The exterior of your home is slowly deteriorating and aging. The sun, wind, rain and temperatures are constantly affecting it. Your job is to monitor the buildings exterior for its condition and weathertightness.

Check the condition of all exterior materials and look for developing patterns of damage or deterioration.

During a heavy rainstorm (without lightning), grab an umbrella and go outside. Walk around your house and look around at the roof and property. A rainstorm is the perfect time to see how the roof, downspouts and grading are performing. Observe the drainage patterns of your entire property, as well as the property of your neighbor. The ground around your house should slope away from all sides. Downspouts, surface gutters and drains should be directing water away from the foundation.

Walkways & Driveways: Driveways, Walkways & Patio Were Inspected

I inspected the driveways, walkways and patio that are adjacent, in-front, and in the back of the house. The walkways, driveways, parking, and patio areas that were far away from the house foundation were not inspected.

Wall-Covering, Flashing & Trim: Type of Wall-Covering Material Described

Brick, Aluminum

The exterior of your home is slowly deteriorating and aging. The sun, wind, rain and temperatures are constantly affecting it. Your job is to monitor the house's exterior for its condition and weathertightness.

Check the condition of all exterior wall-covering materials and look for developing patterns of damage or deterioration.

Eaves, Soffits & Fascia: Eaves, Soffits and Fascia Were Inspected

I inspected the eaves, soffits and fascia. I was not able to inspect every detail, since a home inspection is limited in its scope.

Vegetation, Surface Drainage, Retaining Walls & Grading: Vegetation, Drainage, Walls & Grading Were Inspected

I inspected the vegetation, surface drainage, retaining walls and grading of the property, where they may adversely affect the structure due to moisture intrusion.

Windows: Windows Inspected

A representative number of windows from the ground surface was inspected.

Porches, Patios, Decks, Balconies & Carports: Porches, Patios, Decks, Balconies & Carports Were Inspected

I inspected the porches, patios, decks, balconies and carports at the house that were within the scope of the home inspection.

Stairs, Steps, Stoops, Stairways & Ramps: Stairs, Steps, Stoops, Stairways & Ramps Were Inspected

I inspected the stairs, steps, stoops, stairways and ramps that were within the scope of my home inspection.

All treads should be level and secure. Riser heights and tread depths should be as uniform as possible. As a guide, stairs must have a maximum riser of 7-3/4 inches and a minimum tread of 10 inches.

Railings, Guards & Handrails: Railings, Guards & Handrails Were Inspected

I inspected the railings, guards and handrails that were within the scope of the home inspection.

GFCIs & Electrical: Inspected GFCIs

I inspected ground-fault circuit interrupter receptacles and circuit breakers observed and deemed to be GFCIs using a GFCI tester, where possible.

Limitations

Wall-Covering, Flashing & Trim

INSPECTION WAS RESTRICTED

I did not inspect all of the exterior wall-covering material. A home inspection is not an exhaustive evaluation. My inspection of the exterior was limited. I did not reach and access closely every part of the exterior wall-covering.

Eaves, Soffits & Fascia

INSPECTION WAS RESTRICTED

I did not inspect all of the eaves, soffit, and fascia. It's impossible to inspect those areas closely during a home inspection. A home inspection is not an exhaustive evaluation. My inspection of the exterior was limited. I did not reach and access closely every part of the eaves, soffit, and fascia.

Windows

INSPECTION RESTRICTED

I did not inspect all windows. I did inspect a representative number of them. It's impossible to inspect every window component closely during a home inspection. A home inspection is not an exhaustive evaluation. I did not reach and access closely every window, particularly those above the first floor level.

GFCIs & Electrical

UNABLE TO INSPECT EVERYTHING

I was unable to inspect every electrical component or proper installation of the GFCI system according to modern code. A licensed electrician or township building code inspector could perform that type of test, which is beyond the scope of my visual-only home inspection. I inspected the electrical system as much as I could according to the Home Inspection Standards of Practice.

GFCIs & Electrical

UNABLE TO TEST GFCI

I was unable to test the GFCI at the exterior. Inspection restriction.

Recommendations

2.2.1 Walkways & Driveways

DRIVEWAY: MINOR CRACKING

BACKYARD BY BACK STEPS

I observed indications of minor cracking at the driveway. Correction and further evaluation is recommended.

 Minor Defect



Simple cracks that can be easily filled in with a concrete tube



Simple cracks by entrance of garage they can easily be repaired with simple concrete caulking

2.4.1 Eaves, Soffits & Fascia

MISSING DOWNSPOUT EXTENSIONS

SOUTHWEST CORNER

Recommend downspout extensions to be at least 3' from home.

 Minor Defect

2.5.1 Vegetation, Surface Drainage, Retaining Walls & Grading

TREE DEBRIS ON ROOF

GARAGE ROOF

Tree debris observed on roof. This can cause improper drainage to gutters and downspouts. Recommend clearing debris.

 Major Defect



Over grown vegetation from neighbors yard.

2.6.1 Exterior Doors

SCREEN DOOR DEFECT

BACK SCREEN DOOR

I observed a defect at the screen door.

Correction and further evaluation is recommended.



Missing pneumatic cylinder closing mechanism

3: ROOF

Information

General: Homeowner's Responsibility

Your job as the homeowner is to monitor the roof covering because any roof can leak. To monitor a roof that is inaccessible or that cannot be walked on safely, use binoculars. Look for deteriorating or loosening of flashing, signs of damage to the roof covering and debris that can clog valleys and gutters.

Roofs are designed to be water-resistant. Roofs are not designed to be waterproof. Eventually, the roof system will leak. No one can predict when, where or how a roof will leak.

Every roof should be inspected every year as part of a homeowner's routine home maintenance plan. Catch problems before they become major defects.

Roof Covering: Type of Roof-Covering Described

Asphalt

I observed the roof-covering material and attempted to identify its type.

This inspection is not a guarantee that a roof leak in the future will not happen. Roofs leak. Even a roof that appears to be in good, functional condition will leak under certain circumstances. We will not take responsibility for a roof leak that happens in the future. This is not a warranty or guarantee of the roof system.

Roof Covering: Roof Was Inspected


Ground, Drone

We attempted to inspect the roof from various locations and methods, including from the ground and a ladder.

The inspection was not an exhaustive inspection of every installation detail of the roof system according to the manufacturer's specifications or construction codes. It is virtually impossible to detect a leak except as it is occurring or by specific water tests, which are beyond the scope of our inspection. We recommend that you ask the sellers to disclose information about the roof, and that you include comprehensive roof coverage in your home insurance policy.

Flashing: Wall Intersections

I looked for flashing where the roof covering meets a wall or siding material. There should be step and counter flashing installed in these locations. This is not an exhaustive inspection of all flashing areas.

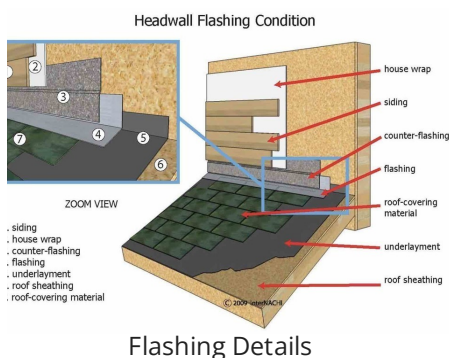

Flashing: Eaves and Gables

I looked for flashing installed at the eaves (near the gutter edge) and at the gables (the diagonal edge of the roof).

There should be metal drip flashing material installed in these locations. The flashing helps the surface water on the roof to discharge into the gutter. Flashing also helps to prevent water intrusion under the roof-covering.

Flue Gas Vent Pipes: Homeowner's Responsibility

Your job is to monitor the flashing around the flue gas vent pipes that pass through the roof surface. Sometimes they deteriorate and cause a roof leak.

Flue Gas Vent Pipes: Flue Gas Vent Pipe Inspected

I looked at flue gas vent pipes that pass through the roof covering.

All gas-fired appliances must be connected to venting systems. There should be watertight metal flashing installed around the flue gas vent pipes. The vent pipes should extend far enough above the roof surface.

Gutters & Downspouts: Homeowner's Responsibility

Your job is to monitor the gutters and be sure that they function during and after a rainstorm. Look for loose parts, sagging gutter ends, and water leaks. The rain water should be diverted far away from the house foundation.

Gutters & Downspouts: Gutters Were Inspected

Front of home

I inspected the gutters. I wasn't able to inspect every inch of every gutter. But I attempted to check the overall general condition of the gutters during the inspection and look for indications of major defects.

Monitoring the gutters during a heavy rain (without lightening) is recommended. In general, the gutters should catch rain water and direct the water towards downspouts that discharge the water away from the house foundation.

Limitations

Roof Covering

UNABLE TO SEE EVERYTHING

This is a visual-only inspection of the roof-covering materials. It does not include an inspection of the entire system. There are components of the roof that are not visible or accessible at all, including the underlayment, decking, fastening, flashing, age, shingle quality, manufacturer installation recommendations, etc.

Roof Covering

UNABLE TO WALK UPON ROOF SURFACE

According to the Home Inspection Standards of Practice, a home inspector is not required to walk upon any roof surface. However, as courtesy only, I attempted to walk upon the roof surface, but was unable. It was not safe. It was not accessible. This was a restriction to my inspection of the roof system. You may want to consider hiring a professional roofer with a lift to check your roof system.

Flashing

DIFFICULT TO SEE EVERY FLASHING

I attempted to inspect the flashing related to the vent pipes, wall intersections, eaves and gables, and the roof-covering materials. In general, there should be flashing installed in certain areas where the roof covering meets something else, like a vent pipe or siding. Most flashing is not observable, because the flashing material itself is covered and hidden by the roof covering or other materials. So, it's impossible to see everything. A home inspection is a limited visual-only inspection.

Flue Gas Vent Pipes

UNABLE TO REACH ALL THE FLUE GAS VENT PIPES

I was unable to closely reach and observe all of the flue gas vent pipes that pass through the roof-covering materials. This was an inspection restriction.

Gutters & Downspouts

COULDN'T REACH THE GUTTERS

I was unable to closely reach and closely inspect the installation of all of the gutter components and systems.

Recommendations

3.2.1 Roof Covering



ROOF: DISCOLORATION STAIN FROM ALGAE

GARAGE ROOF

I observed indications of staining and discoloration on the roof-covering materials. This condition seemed to be caused from algae. What we commonly call algae is actually not algae, but a type of bacteria capable of photosynthesis. Algae appears as dark streaks, which are actually the dark sheaths produced by the organisms to protect themselves from UV radiation. When environmental conditions are right, the problem can spread quickly across a roof.

Algae attaches itself to the shingle by secreting a substance that bonds it tightly to the surface. Growth can be difficult to remove without damaging the roof. The best method is prevention. Algae stains can sometimes be lightened in color by using special cleaners.

Power-washing and heavy scrubbing may loosen or dislodge granules. Chemicals used for cleaning shingles may damage landscaping. Also, the cleaning process makes the roof wet and slippery, so such work should be performed by a qualified professional.

3.5.1 Gutters & Downspouts



DEBRIS IN GUTTERS

FRONT OF HOME

I observed debris in the gutter. Cleaning and maintenance is recommended.

4: CHIMNEY, FIREPLACE, OR STOVE

Information

Masonry Chimney: Masonry Chimney Exterior Was Inspected

The chimney exterior was inspected during my home inspection.

Heating System Masonry Chimney: Heating Chimney Exterior Was Inspected

The chimney exterior was inspected during my home inspection.

Fireplace: Type of Fireplace

Masonry

I tried to describe the type of fireplace.

Fireplace: Lintel

I observed the lintel above the fireplace opening.

Fireplace: Cleanout Door and Frame

I inspected the fireplace cleanout doors and frames

Floor Structure: Basement/Crawlspace Floor

Concrete

Floor Structure: Material

Concrete

Floor Structure: Sub-floor

Plywood

Masonry Chimney: Masonry Chimney Flashing Was Inspected

I inspected for flashing installed at the chimney.

Flashing is installed in areas where the chimney stack meets another system or component of the house. And the flashing is supposed to divert water away from those areas to prevent water intrusion.

Masonry Chimney: Masonry Chimney Hood or Cap Installed

A hood or cap was installed at the masonry chimney. Good.

Masonry chimneys without hoods should have stone or reinforced concrete caps at the top. Some masonry chimneys have hoods over the flues. Hoods on masonry chimneys consist of stone or reinforced concrete caps supported on short masonry columns at the perimeter of chimney tops, or sheet metal caps supported on short sheet metal columns.

Heating System Masonry Chimney: Heating Chimney Flashing Was Inspected

I inspected for flashing installed at the chimney.

Flashing is installed in areas where the chimney stack meets another system or component of the house. And the flashing is supposed to divert water away from those areas to prevent water intrusion.

Heating System Masonry Chimney: Heating Chimney Hood or Cap Installed

A hood or cap was installed at the masonry chimney. Good.

Masonry chimneys without hoods should have stone or reinforced concrete caps at the top. Some masonry chimneys have hoods over the flues. Hoods on masonry chimneys consist of stone or reinforced concrete caps supported on short masonry columns at the perimeter of chimney tops, or sheet metal caps supported on short sheet metal columns.

Fireplace: Damper Door

I inspected the fireplace damper doors by opening and closing them, if they were readily accessible and manually operable.

Limitations

Masonry Chimney

CHIMNEY INTERIOR IS BEYOND THE SCOPE

Inspecting the chimney interior and flue is beyond the scope of a home inspection. An inspector is not required to inspect the flue or vent system, and is not required to inspect the interior of chimneys or flues, fire doors or screens, seals or gaskets, or mantels. Out of courtesy only, the inspector may take a look at readily accessible and visible parts of the chimney flue.

Heating System Masonry Chimney

CHIMNEY INTERIOR IS BEYOND THE SCOPE

Inspecting the chimney interior and flue is beyond the scope of a home inspection. An inspector is not required to inspect the flue or vent system, and is not required to inspect the interior of chimneys or flues, fire doors or screens, seals or gaskets, or mantels. Out of courtesy only, the inspector may take a look at readily accessible and visible parts of the chimney flue.

Fireplace

FIREPLACE AND STACK INSPECTION LIMITATIONS

Not everything of the fireplace and chimney stack system and components are inspected because they are not part of the Home Inspection Standards of Practice. I inspected only what I am required to inspect and only what was visible during the home inspection. I recommend hiring a certified chimney sweep to inspect, sweep, and further evaluate the interior of the fireplace system immediately and every year as part of a homeowner's routine maintenance plan.

Recommendations

4.1.1 Masonry Chimney

CHIMNEY RAIN CAP MISSING

BACK ADDITION FIREPLACE

I observed a missing chimney rain cap. The rain cap covers the top opening of the chimney flue liner. The cap is missing for the stove exhaust built into the fireplace. Also shown in the photo, recommended mortar tuck and point.



Major Defect



Missing Rain Cap on fire place stove exhaust. Should be properly covered. Recommend point and tuck mortar repair.

5: BASEMENT, FOUNDATION, CRAWLSPACE & STRUCTURE

Information

Basement: Type of Basement Foundation Described

Concrete

Insulation in Foundation/Basement Area: Type of Insulation Observed

Batt

Ventilation in Foundation/Basement Area: Insulation Type

None

Basement: Homeowner's Responsibility

One of the most common problems in a house is a wet basement or foundation. You should monitor the walls and floors for signs of water penetration, such as dampness, water stains, peeling paint, efflorescence, and rust on exposed metal parts. In a finished basement, look for rotted or warped wood paneling and doors, loose floor tiles, and mildew stains. It may come through the walls or cracks in the floor, or from backed-up floor drains, leaky plumbing lines, or a clogged air-conditioner condensate line.

Basement: Basement Was Inspected

The basement was inspected according to the [Home Inspection Standards of Practice](#).

The basement can be a revealing area in the house and often provides a general picture of how the entire structure works. In most basements, the structure is exposed overhead, as are the HVAC distribution system, plumbing supply and DWV lines, and the electrical branch-circuit wiring. I inspected those systems and components.

Basement: Foundation Was Inspected

The foundation was inspected according to the [Home Inspection Standards of Practice](#).

Basement: Structural Components Were Inspected

Structural components were inspected according to the [Home Inspection Standards of Practice](#), including readily observed floor joists.

Insulation in Foundation/Basement Area: Approximate Average Depth of Insulation

insulation thickness varied greatly

Determining how much insulation should be installed in a house depends upon where a home is located. proper amount of insulation should be installed at a particular area of a house is dependent upon which climate zone the house is located.

This house is located in a climate zone that requires an R-value of

Ventilation in Foundation/Basement Area: Ventilation Inspected

During the home inspection, I inspected for insulation in unfinished spaces, including attics, crawlspaces and foundation areas. And I inspected mechanical exhaust systems in the kitchen, bathrooms and laundry area.

I report as in need of correction the general absence of ventilation in unfinished spaces.

Ventilation in Foundation/Basement Area: Attic Insulation Thickness

insulation thickness varied greatly

Determining how much insulation should be installed in a house depends upon where a home is located. proper amount of insulation should be installed at a particular area of a house is dependent upon which climate zone the house is located.

This house is located in a climate zone that requires an R-value of

Limitations

Basement

BASEMENT FINISHED

The basement was finished. This was an inspection restriction, because the finished floor, walls, and ceiling blocked my visual inspection of the basement, its systems and components.

Insulation in Foundation/Basement Area

FINISHED BASEMENT

Could not check insulation behind the paneling.

6: HEATING

Information

Heating System Information: Energy Source

Gas

Heating System Information: Heating Method

Hot-Water Heating System,
Warm-Air Heating System

Thermostat and Normal Operating Controls: Thermostat Location

Multiple locations

Heating System Information: Homeowner's Responsibility

Most HVAC (heating, ventilating and air-conditioning) systems in houses are relatively simple in design and operation. They consist of four components: controls, fuel supply, heating or cooling unit, and distribution system. The adequacy of heating and cooling is often quite subjective and depends upon occupant perceptions that are affected by the distribution of air, the location of return-air vents, air velocity, the sound of the system in operation, and similar characteristics.

It's your job to get the HVAC system inspected and serviced every year. And if you're system as an air filter, be sure to keep that filter cleaned.

Thermostat and Normal Operating Controls: Emergency Shut-Off Switch Inspected

I observed an emergency shut-off switch. I inspected it. It worked when I used it during my inspection.

Thermostat and Normal Operating Controls: Service Switch Inspected

I observed a service switch. I inspected it. It worked when I used it during my inspection.

7: COOLING

Information

Thermostat and Normal

Operating Controls: Thermostat

Location

Multiple locations

Cooling System Information: Homeowner's Responsibility

Most air-conditioning systems in houses are relatively simple in design and operation. The adequacy of the cooling is often quite subjective and depends upon occupant perceptions that are affected by the distribution of air, the location of return-air vents, air velocity, the sound of the system in operation, and similar characteristics.

It's your job to get the air conditioning system inspected and serviced every year. And if you're system as an air filter, be sure to keep that filter cleaned.

8: PLUMBING

Information

Main Water Shut-Off Valve:	Hot Water Source: Inspected TPR Valve	Hot Water Source: Inspected Venting Connections
Location of Main Shut-Off Valve		
Basement	I inspected the temperature and pressure relief valve.	I inspected the venting connections.

Main Water Shut-Off Valve: Homeowner's Responsibility

It's your job to know where the main water and fuel shutoff valves are located. And be sure to keep an eye out for any water and plumbing leaks.

Water Supply : Water Supply Is Public

The water supply to the house appeared to be from the public water supply source based upon the observed indications at the time of the inspection. To confirm and be certain, I recommend asking the homeowner for details.

Hot Water Source: Type of Hot Water Source

Gas-Fired Hot Water Tank

I inspected for the main source of the distributed hot water to the plumbing fixtures (sinks, tubs, showers). I recommend asking the homeowner for details about the hot water equipment and past performance.

Hot Water Source: Inspected Hot Water Source

I inspected the hot water source and equipment according to the [Home Inspection Standards of Practice](#).

Drain, Waste, & Vent Systems: Inspected Drain, Waste, Vent Pipes

I attempted to inspect the drain, waste, and vent pipes. Not all of the pipes and components were accessible and observed. Inspection restriction. Ask the homeowner about water and sewer leaks or blockages in the past.

Water Supply & Distribution Systems: Inspected Water Supply & Distribution Pipes

I attempted to inspect the water supply and distribution pipes (plumbing pipes). Not all of the pipes and components were accessible and observed. Inspection restriction. Ask the homeowner about water supply, problems with water supply, and water leaks in the past.

Limitations

Main Water Shut-Off Valve

WATER TURNED OFF AT MAIN VALVE

NORTHEAST CORNER OF BASEMENT

I observed that the main water shut-off valve was turned off. There was no water running at the house. Inspection restriction.

Drain, Waste, & Vent Systems

NOT ALL PIPES WERE INSPECTED

The inspection was restricted because not all of the pipes were exposed, readily accessible, and observed. For example, most of the drainage pipes were hidden within the walls.

Water Supply & Distribution Systems

NOT ALL PIPES WERE INSPECTED

The inspection was restricted because not all of the water supply pipes were exposed, readily accessible, and observed. For example, most of the water distribution pipes, valves and connections were hidden within the walls.

9: ELECTRICAL

Information

Electric Meter & Base: Inspected the Electric Meter & Base

Back of home South East corner

I inspected the electrical electric meter and base.




240 volt service

Service-Entrance Conductors: Inspected Service-Entrance Conductors

Back of home southeast corner

I inspected the electrical service-entrance conductors.

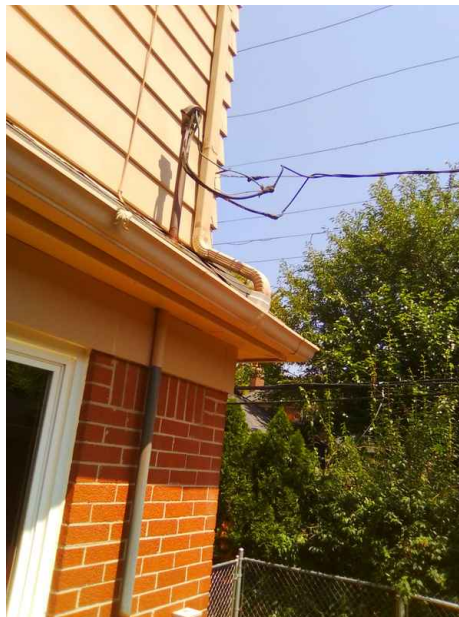

Recommend 18" drip loop

Main Service Disconnect: Inspected Main Service Disconnect


I inspected the electrical main service disconnect.

Electrical Wiring: Type of Wiring, If Visible

NM-B (Romex)

Service Grounding & Bonding: Inspected the Service Grounding & Bonding

I inspected the electrical service grounding and bonding.

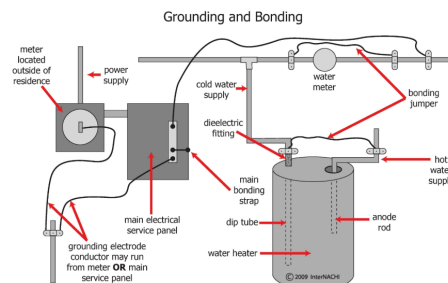

Main Service Disconnect: Homeowner's Responsibility

It's your job to know where the main electrical panel is located, including the main service disconnect that turns everything off.

Be sure to test your GFCIs, AFCIs, and smoke detectors regularly. You can replace light bulbs, but more than that, you ought to hire an electrician. Electrical work is hazardous and mistakes can be fatal. Hire a professional whenever there's an electrical problem in your house.

Main Service Disconnect: Main Disconnect Rating, If Labeled

200

I observed indications of the main service disconnect's amperage rating. It was labeled.

Panelboards & Breakers: Inspected Main Panelboard & Breakers

I inspected the electrical panelboards and over-current protection devices (circuit breakers and fuses).

Panelboards & Breakers: Inspected Subpanel & Breakers

I inspected the electrical subpanel and over-current protection devices (circuit breakers and fuses).

GFCIs: Inspected GFCIs

I inspected ground-fault circuit interrupter receptacles and circuit breakers observed and deemed to be GFCIs using a GFCI tester, where possible.

Limitations

Electrical Wiring

UNABLE TO INSPECT ALL OF THE WIRING

I was unable to inspect all of the electrical wiring. Obviously, most of the wiring is hidden from view within walls. Beyond the scope of a visual home inspection.

Service Grounding & Bonding

UNABLE TO CONFIRM PROPER GROUNDING AND BONDING

I was unable to confirm proper installation of the system grounding and bonding according to modern code. A licensed electrician or township building code inspector could perform that type of test, which is beyond the scope of my visual-only home inspection. I inspected the grounding and bonding as much as I could according to the Home Inspection Standards of Practice.

AFCIs

UNABLE TO INSPECT EVERYTHING

I was unable to inspect every electrical component or proper installation of the AFCI system according to modern code. A licensed electrician or township building code inspector could perform that type of test, which is beyond the scope of my visual-only home inspection. I inspected the electrical system as much as I could according to the Home Inspection Standards of Practice.

GFCIs

UNABLE TO INSPECT EVERYTHING

I was unable to inspect every electrical component or proper installation of the GFCI system according to modern code. A licensed electrician or township building code inspector could perform that type of test, which is beyond the scope of my visual-only home inspection. I inspected the electrical system as much as I could according to the Home Inspection Standards of Practice.

10: ATTIC, INSULATION & VENTILATION

Information

Insulation in Attic: Type of Insulation Observed

Cellulose, Fiberglass

Structural Components & Observations in Attic: Structural Components Were Inspected

Structural components were inspected from the attic space according to the [Home Inspection Standards of Practice](#).

Insulation in Attic: Insulation Was Inspected

Attic

During the home inspection, I inspected for insulation in unfinished spaces, including attics, crawlspaces and foundation areas. I inspected for ventilation of unfinished spaces, including attics, crawlspaces and foundation areas. And I inspected mechanical exhaust systems in the kitchen, bathrooms and laundry area.

I attempted to describe the type of insulation observed and the approximate average depth of insulation observed at the unfinished attic floor area or roof structure.

I reported as in need of correction the general absence of insulation or ventilation in unfinished spaces.

Insulation in Attic: Approximate Average Depth of Insulation

6-9 inches

Determining how much insulation should be installed in a house depends upon where a home is located. The amount of insulation that should be installed at a particular area of a house is dependent upon which climate zone the house is located and the local building codes.

Ventilation in Attic: Ventilation Inspected

During the home inspection, I inspected for ventilation in unfinished spaces, including attics, crawlspaces and foundation areas. And I inspected for mechanical exhaust systems.

I report as in need of correction the general absence of ventilation in unfinished spaces.

Limitations

Structural Components & Observations in Attic

COULD NOT SEE EVERYTHING IN ATTIC

I could not see and inspect everything in the attic space. The access is restricted and my inspection is limited.

11: BATHROOMS

Information

Bathroom Toilets: Toilets

Inspected

I flushed all of the toilets.

Sinks, Tubs & Showers: Ran Water at Sinks, Tubs & Showers

I ran water at all bathroom sinks, bathtubs, and showers. I inspected for deficiencies in the water supply by viewing the functional flow in two fixtures operated simultaneously.

Bathroom Exhaust Fan / Window: Inspected Bath Exhaust Fans

I inspected the exhaust fans of the bathroom(s). All mechanical exhaust fans should terminate outside. Confirming that the fan exhausts outside is beyond the scope of a home inspection.

GFCI & Electric in Bathroom: GFCI-Protection Tested

I inspected the GFCI-protection at the receptacle near the bathroom sink by pushing the test button at the GFCI device or using a GFCI testing instrument.

All receptacles in the bathroom must be GFCI protected.

12: DOORS, WINDOWS & INTERIOR

Information

Doors: Doors Inspected

I inspected a representative number of doors according to the [Home Inspection Standards of Practice](#) by opening and closing them. I did not operate door locks and door stops, which is beyond the scope of a home inspection.

Windows: Windows Inspected

I inspected a representative number of windows according to the [Home Inspection Standards of Practice](#) by opening and closing them. I did not operate window locks and operation features, which is beyond the scope of a home inspection.

Switches, Fixtures & Receptacles: Inspected a Switches, Fixtures & Receptacles

I inspected a representative number of switches, lighting fixtures and receptacles.

Floors, Walls, Ceilings: Floors, Walls, Ceilings Inspected

I inspected the readily visible surfaces of floors, walls and ceilings. I looked for material defects according to the [Home Inspection Standards of Practice](#).

Stairs, Steps, Stoops, Stairways & Ramps: Stairs, Steps, Stoops, Stairways & Ramps Were Inspected

I inspected the stairs, steps, stoops, stairways and ramps that were within the scope of my home inspection.

All treads should be level and secure. Riser heights and tread depths should be as uniform as possible. As a guide, stairs must have a maximum riser of 7-3/4 inches and a minimum tread of 10 inches.

Railings, Guards & Handrails: Railings, Guards & Handrails Were Inspected

I inspected a representative number railings, guards and handrails that were within the scope of the home inspection.

Presence of Smoke and CO Detectors: Inspected for Presence of Smoke and CO Detectors

I inspected for the presence of smoke and carbon-monoxide detectors.

There should be a smoke detector in every sleeping room, outside of every sleeping room, and one every level of a house.

Limitations

Switches, Fixtures & Receptacles

UNABLE TO INSPECT EVERYTHING

I was unable to inspect every electrical component or proper installation of the system according to modern code. A licensed electrician or township building code inspector could perform that type of test, which is beyond the scope of my visual-only home inspection. I inspected the electrical system as much as I could according to the Home Inspection Standards of Practice.

Recommendations

12.7.1 Presence of Smoke and CO Detectors

 Major Defect

MISSING SMOKE DETECTOR

BASEMENT

I observed indications of a missing smoke detector. Hazard.

12.7.2 Presence of Smoke and CO Detectors

 Major Defect

MISSING CO DETECTOR

BASEMENT

I observed indications of a missing carbon monoxide detector. Hazard.

13: LAUNDRY

Limitations

Clothes Washer

DID NOT INSPECT

I did not inspect the clothes washer and dryer fully. These appliances are beyond the scope of a home inspection. I did not operate the appliances. The clothes dryer exhaust pipe must be inspected and cleaned every year to help prevent house fires.

Clothes Dryer

DID NOT INSPECT

I did not inspect the clothes washer and dryer fully. These appliances are beyond the scope of a home inspection. I did not operate the appliances. The clothes dryer exhaust pipe must be inspected and cleaned every year to help prevent house fires.

14: DETACHED GARAGE

Information

Garage Floor: Garage Floor Inspected

I inspected the floor of the attached garage.

Garage Vehicle Door: Type of Door Operation

Opener

Exterior Door: Exterior Doors Inspected

I inspected the exterior doors of the detached garage.

Roof Covering: Homeowner's Responsibility

Your job as the homeowner is to monitor the roof covering because any roof can leak. To monitor a roof that is inaccessible or that cannot be walked on safely, use binoculars. Look for deteriorating or loosening of flashing, signs of damage to the roof covering and debris that can clog valleys and gutters.

Roofs are designed to be water-resistant. Roofs are not designed to be waterproof. Eventually, the roof system will leak. No one can predict when, where or how a roof will leak.

Roof Covering: Type of Roof-Covering Described

Asphalt

I observed the roof-covering material and attempted to identify its type.

This inspection is not a guarantee that a roof leak in the future will not happen. Roofs leak. Even a roof that appears to be in good, functional condition will leak under certain circumstances. We will not take responsibility for a roof leak that happens in the future. This is not a warranty or guarantee of the roof system.

Roof Covering: Roof Was Inspected

Drone, Ground

We attempted to inspect the roof from various locations and methods, including from the ground and a ladder.

The inspection was not an exhaustive inspection of every installation detail of the roof system according to the manufacturer's specifications or construction codes. It is virtually impossible to detect a leak except as it is occurring or by specific water tests, which are beyond the scope of our inspection. We recommend that you ask the sellers to disclose information about the roof, and that you include comprehensive roof coverage in your home insurance policy.

Roof Flashing: Wall Intersections

I looked for flashing where the roof covering meets a wall or siding material. There should be step and counter flashing installed in these locations. This is not an exhaustive inspection of all flashing areas.

Roof Flashing: Eaves and Gables

I looked for flashing installed at the eaves (near the gutter edge) and at the gables (the diagonal edge of the roof).

There should be metal drip flashing material installed in these locations. The flashing helps the surface water on the roof to discharge into the gutter. Flashing also helps to prevent water intrusion under the roof-covering.

Gutters & Downspouts: Homeowner's Responsibility

Your job is to monitor the gutters and be sure that they function during and after a rainstorm. Look for loose parts, sagging gutter ends, and water leaks. The rain water should be diverted far away from the house foundation.

Eaves, Soffits & Fascia: Eaves, Soffits and Fascia Were Inspected

I inspected the eaves, soffits and fascia. I was not able to inspect every detail, since a home inspection is limited in its scope.

Vegetation, Surface Drainage, Retaining Walls & Grading: Vegetation, Drainage, Walls & Grading Were Inspected

I inspected the vegetation, surface drainage, retaining walls and grading of the property, where they may adversely affect the structure due to moisture intrusion.

Wall-Covering, Flashing & Trim: Type of Wall-Covering Material Described

Brick, Aluminum

The exterior of your home is slowly deteriorating and aging. The sun, wind, rain and temperatures are constantly affecting it. Your job is to monitor the house's exterior for its condition and weathertightness.

Check the condition of all exterior wall-covering materials and look for developing patterns of damage or deterioration.

Electric/GFCI Outside Garage: Inspected GFCIs

I inspected ground-fault circuit interrupter receptacles and circuit breakers observed and deemed to be GFCIs using a GFCI tester, where possible.

Stairs, Steps, Stoops, Stairways & Ramps: Stairs, Steps, Stoops, Stairways & Ramps Were Inspected

I inspected the stairs, steps, stoops, stairways and ramps that were within the scope of my home inspection.

All treads should be level and secure. Riser heights and tread depths should be as uniform as possible. As a guide, stairs must have a maximum riser of 7-3/4 inches and a minimum tread of 10 inches.

Railings, Guards & Handrails: Railings, Guards & Handrails Were Inspected

I inspected the railings, guards and handrails that were within the scope of the home inspection.

Ceiling & Walls in Garage: Garage Ceiling & Walls Were Inspected

I inspected the ceiling and walls of the detached garage according to the Home Inspection Standards of Practice.

Windows: Windows Inspected

A representative number of windows from the ground surface was inspected at the detached garage.

Limitations

Roof Covering

UNABLE TO SEE EVERYTHING

This is a visual-only inspection of the roof-covering materials. It does not include an inspection of the entire system. There are components of the roof that are not visible or accessible at all, including the underlayment, decking, fastening, flashing, age, shingle quality, manufacturer installation recommendations, etc.

Roof Covering

UNABLE TO WALK UPON ROOF SURFACE

According to the Home Inspection Standards of Practice, a home inspector is not required to walk upon any roof surface. However, as courtesy only, I attempted to walk upon the roof surface, but was unable. It was not safe. It was not accessible. This was a restriction to my inspection of the roof system. You may want to consider hiring a professional roofer with a lift to check your roof system.

Roof Flashing

DIFFICULT TO SEE EVERY FLASHING

I attempted to inspect the flashing related to the vent pipes, wall intersections, eaves and gables, and the roof-covering materials. In general, there should be flashing installed in certain areas where the roof covering meets something else, like a vent pipe or siding. Most flashing is not observable, because the flashing material itself is covered and hidden by the roof covering or other materials. So, it's impossible to see everything. A home inspection is a limited visual-only inspection.

Gutters & Downspouts

DIFFICULT TO REACH THE GUTTERS

I was unable to closely reach and closely inspect the installation of all of the gutter components and systems.

Eaves, Soffits & Fascia

INSPECTION WAS RESTRICTED

I did not inspect all of the eaves, soffit, and fascia. It's impossible to inspect those areas closely during a home inspection. A home inspection is not an exhaustive evaluation. My inspection of the exterior was limited. I did not reach and access closely every part of the eaves, soffit, and fascia.

Electric/GFCI Outside Garage

UNABLE TO INSPECT EVERYTHING

I was unable to inspect every electrical component or proper installation of the GFCI system according to modern code. A licensed electrician or township building code inspector could perform that type of test, which is beyond the scope of my visual-only home inspection. I inspected the electrical system as much as I could according to the Home Inspection Standards of Practice.

Ceiling & Walls in Garage

CAN'T SEE EVERYTHING

I can not observe everything. Inspection restrictions. My inspection was limited.

Windows

INSPECTION RESTRICTED

I did not inspect all windows. I did inspect a representative number of them. It's impossible to inspect every window component closely during a home inspection. A home inspection is not an exhaustive evaluation. I did not reach and access closely every window, particularly those above the first floor level.

Recommendations

14.7.1 Electric/GFCI Outside Garage

MISSING GFCI

I observed indications that a GFCI is missing in an area that is required to keep people safe.

14.14.1 Electric in the Garage



MISSING GFCI-PROTECTION IN GARAGE

I observed a receptacle in the attached garage without GFCI (or ground fault circuit interrupter) protection.

GFCI protection is required for all 15- and 20-amp receptacles, including outlets for refrigerators, garage door openers, and washing machines.

15: KITCHEN

Information

GFCI: GFCI Tested

I observed ground fault circuit interrupter (GFCI) protection in the kitchen.

Countertops & Cabinets: Inspected Cabinets & Countertops

I inspected a representative number of cabinets and countertop surfaces.

Floors, Walls, Ceilings: Floors, Walls, Ceilings Inspected

I inspected the readily visible surfaces of floors, walls and ceilings. I looked for material defects according to the [Home Inspection Standards of Practice](#).

STANDARDS OF PRACTICE

Inspection Detail

Please refer to the [Home Inspection Standards of Practice](#) while reading this inspection report. I performed the home inspection according to the standards and my clients wishes and expectations. Please refer to the inspection contract or agreement between the inspector and the inspector's client.

Exterior

Please refer to the [Home Inspection Standards of Practice](#) related to inspecting the exterior of the house.

I. The inspector shall inspect:

1. the exterior wall-covering materials;
2. the eaves, soffits and fascia;
3. a representative number of windows;
4. all exterior doors;
5. flashing and trim;
6. adjacent walkways and driveways;
7. stairs, steps, stoops, stairways and ramps;
8. porches, patios, decks, balconies and carports;
9. railings, guards and handrails; and
10. vegetation, surface drainage, retaining walls and grading of the property, where they may adversely affect the structure due to moisture intrusion.

II. The inspector shall describe:

1. the type of exterior wall-covering materials.

III. The inspector shall report as in need of correction:

1. any improper spacing between intermediate balusters, spindles and rails.

Roof

Please refer to the [Home Inspection Standards of Practice](#) related to inspecting the roof of the house.

Monitor the roof covering because any roof can leak. To monitor a roof that is inaccessible or that cannot be walked on safely, use binoculars. Look for deteriorating or loosening of flashing, signs of damage to the roof covering and debris that can clog valleys and gutters.

Roofs are designed to be water-resistant. Roofs are not designed to be waterproof. Eventually, the roof system will leak. No one can predict when, where or how a roof will leak.

I. The inspector shall inspect from ground level or the eaves:

1. the roof-covering materials;
2. the gutters;
3. the downspouts;
4. the vents, flashing, skylights, chimney, and other roof penetrations; and
5. the general structure of the roof from the readily accessible panels, doors or stairs.

II. The inspector shall describe:

1. the type of roof-covering materials.

III. The inspector shall report as in need of correction:

1. observed indications of active roof leaks.

Chimney, Fireplace, or Stove

I. The inspector shall inspect:

1. readily accessible and visible portions of the fireplaces and chimneys;
2. lintels above the fireplace openings;
3. damper doors by opening and closing them, if readily accessible and manually operable; and
4. cleanout doors and frames.

II. The inspector shall describe:

1. the type of fireplace.

III. The inspector shall report as in need of correction:

1. evidence of joint separation, damage or deterioration of the hearth, hearth extension or chambers;
2. manually operated dampers that did not open and close;
3. the lack of a smoke detector in the same room as the fireplace;
4. the lack of a carbon-monoxide detector in the same room as the fireplace; and
5. cleanouts not made of metal, pre-cast cement, or other non-combustible material.

Basement, Foundation, Crawlspace & Structure

I. The inspector shall inspect:

the foundation;
the basement;
the crawlspace; and
structural components.

II. The inspector shall describe:

the type of foundation; and
the location of the access to the under-floor space.

III. The inspector shall report as in need of correction:

observed indications of wood in contact with or near soil;
observed indications of active water penetration;
observed indications of possible foundation movement, such as sheetrock cracks, brick cracks, out-of-square door frames, and unlevel floors; and
any observed cutting, notching and boring of framing members that may, in the inspector's opinion, present a structural or safety concern.

Heating

I. The inspector shall inspect:

1. the heating system, using normal operating controls.

II. The inspector shall describe:

1. the location of the thermostat for the heating system;
2. the energy source; and
3. the heating method.

III. The inspector shall report as in need of correction:

1. any heating system that did not operate; and
2. if the heating system was deemed inaccessible.

Cooling

I. The inspector shall inspect:

1. the cooling system, using normal operating controls.

II. The inspector shall describe:

1. the location of the thermostat for the cooling system; and
2. the cooling method.

III. The inspector shall report as in need of correction:

1. any cooling system that did not operate; and
2. if the cooling system was deemed inaccessible.

Plumbing**I. The inspector shall inspect:**

1. the main water supply shut-off valve;
2. the main fuel supply shut-off valve;
3. the water heating equipment, including the energy source, venting connections, temperature/pressure-relief (TPR) valves, Watts 210 valves, and seismic bracing;
4. interior water supply, including all fixtures and faucets, by running the water;
5. all toilets for proper operation by flushing;
6. all sinks, tubs and showers for functional drainage;
7. the drain, waste and vent system; and
8. drainage sump pumps with accessible floats.

II. The inspector shall describe:

1. whether the water supply is public or private based upon observed evidence;
2. the location of the main water supply shut-off valve;
3. the location of the main fuel supply shut-off valve;
4. the location of any observed fuel-storage system; and
5. the capacity of the water heating equipment, if labeled.

III. The inspector shall report as in need of correction:

1. deficiencies in the water supply by viewing the functional flow in two fixtures operated simultaneously;
2. deficiencies in the installation of hot and cold water faucets;
3. active plumbing water leaks that were observed during the inspection; and
4. toilets that were damaged, had loose connections to the floor, were leaking, or had tank components that did not operate.

Electrical**I. The inspector shall inspect:**

1. the service drop;
2. the overhead service conductors and attachment point;
3. the service head, gooseneck and drip loops;
4. the service mast, service conduit and raceway;
5. the electric meter and base;
6. service-entrance conductors;
7. the main service disconnect;
8. panelboards and over-current protection devices (circuit breakers and fuses);
9. service grounding and bonding;
10. a representative number of switches, lighting fixtures and receptacles, including receptacles observed and deemed to be arc-fault circuit interrupter (AFCI)-protected using the AFCI test button, where possible;
11. all ground-fault circuit interrupter receptacles and circuit breakers observed and deemed to be GFCIs using a GFCI tester, where possible; and
12. for the presence of smoke and carbon-monoxide detectors.

II. The inspector shall describe:

1. the main service disconnect's amperage rating, if labeled; and
2. the type of wiring observed.

III. The inspector shall report as in need of correction:

1. deficiencies in the integrity of the service-entrance conductors insulation, drip loop, and vertical clearances from grade and roofs;
2. any unused circuit-breaker panel opening that was not filled;
3. the presence of solid conductor aluminum branch-circuit wiring, if readily visible;
4. any tested receptacle in which power was not present, polarity was incorrect, the cover was not in place, the GFCI devices were not properly installed or did not operate properly, evidence of arcing or excessive heat, and where the receptacle was not grounded or was not secured to the wall; and
5. the absence of smoke and/or carbon monoxide detectors.

Attic, Insulation & Ventilation**The inspector shall inspect:**

insulation in unfinished spaces, including attics, crawlspaces and foundation areas; ventilation of unfinished spaces, including attics, crawlspaces and foundation areas; and mechanical exhaust systems in the kitchen, bathrooms and laundry area.

The inspector shall describe:

the type of insulation observed; and the approximate average depth of insulation observed at the unfinished attic floor area or roof structure.

The inspector shall report as in need of correction:

the general absence of insulation or ventilation in unfinished spaces.

Bathrooms**The home inspector will inspect:**

interior water supply, including all fixtures and faucets, by running the water; all toilets for proper operation by flushing; and all sinks, tubs and showers for functional drainage.

Doors, Windows & Interior**The inspector shall inspect:**

a representative number of doors and windows by opening and closing them; floors, walls and ceilings; stairs, steps, landings, stairways and ramps; railings, guards and handrails; and garage vehicle doors and the operation of garage vehicle door openers, using normal operating controls.

The inspector shall describe:

a garage vehicle door as manually-operated or installed with a garage door opener.

The inspector shall report as in need of correction:

improper spacing between intermediate balusters, spindles and rails for steps, stairways, guards and railings; photo-electric safety sensors that did not operate properly; and any window that was obviously fogged or displayed other evidence of broken seals.

Laundry**The inspector shall inspect:**

mechanical exhaust systems in the kitchen, bathrooms and laundry area.

Detached Garage**The inspector shall inspect:**

garage vehicle doors and the operation of garage vehicle door openers, using normal operating controls.

The inspector shall describe:

a garage vehicle door as manually-operated or installed with a garage door opener.

Kitchen

The kitchen appliances are not included in the scope of a home inspection according to the Standards of Practice.

The inspector will out of courtesy only check:

the stove,
oven,
microwave, and
garbage disposer.